

## Step 1

### Dock the instrument

Allow the docking station to complete any scheduled instrument tasks. Watch for an **LED indicator** of green, amber, or red. If indicator is red – DO NOT USE THE INSTRUMENT. If indicator on the docking station is green, or green and amber, proceed to Step 2.




## Step 2

### Turn on the instrument

Press and hold for 3 seconds, then release for start-up.

The instrument runs through a series of screens until it reaches the Gas Readings screen.

Check the **battery** to ensure it is fully charged.

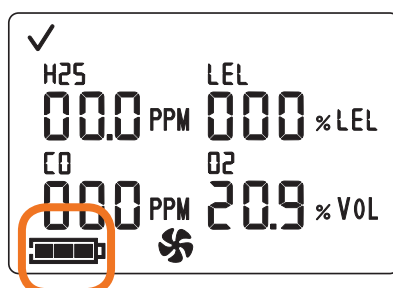

## Step 3

### Zero the instrument in fresh air

Press multiple times to get to the Zero Initiate screen.

Press to start the zero process.



The Zero Results screen will indicate **Pass**, displayed with a check mark,

or **Fail**, displayed with an "F" or "P" for each failed or passed sensor.

If the results indicate **Pass** move on to step 3.

If the results indicate **Fail** press to return to the Zero Initiate screen.

Repeat the Zero process.

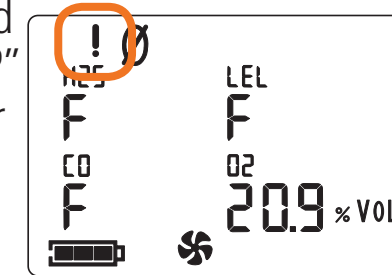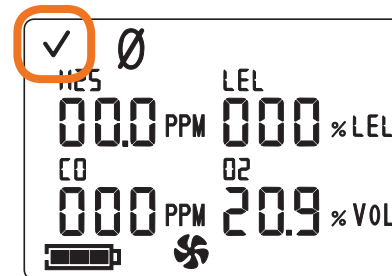


## Step 4

### Clear the peak readings

Press until the **Peak** Readings screen is shown.

Press once to clear the peak values.

Press until the instrument returns to the Gas Readings screen.

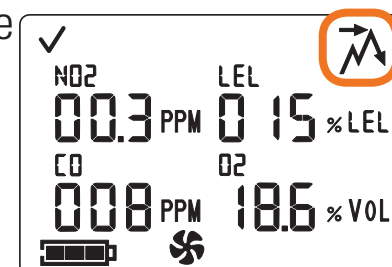

INSTRUMENT IS READY FOR USE

